



Full Member



ABN 48 795 006 590

1/177 Power St, Glendenning, NSW, 2761
Phone: (02) 9838 4735



Full Member

VISUAL INSPECTION REPORT

| | | | |
|----------------------|-------------------------|------------------|-------------------|
| Customer: | RAR CRANES AUSTRALIA | Contact: | JAMES S |
| Location: | UNIT 950 | Inspection Date: | 09/02/2026 |
| D/D No: | N/A | Report No: | 258654 / UNIT 950 |
| Report Received by: | andrewb@rargroup.com.au | Customer O/N: | N/A |
| Next Inspection Due: | FEBRUARY 2027 | Colour Code: | RED |

This report follows the visual inspection of lifting gear performed by Hasan Ozbal. Inspections were conducted with reference to Company endorsed Work Instructions, Relevant Standards, Occupational Health & Safety requirements and Manufacturers recommendations to determine acceptance / rejection criteria's.

1. AS 3775.2:2014 Chain slings for lifting purposes - grade T(80) and V(100) product specification
2. AS 3776 :2015 Lifting components for grade T(80) and V(100) chain slings

All items satisfying the above requirements were tagged or hard stamped to cross reference with this report.

Items listed as "R" (Repair) should be quarantined and repaired prior to further use.
 Items listed as "F" (Failed) are not suitable for continued use or for their intended purpose and should be destroyed and discarded immediately. We cannot accept any responsibility for continued use.
 Items listed as "N" (Not Presented) were unable to be located on site.
 Items listed as "P" (Pass) are suitable for continued use and can be put back into service. Should any replacement parts be required they can be supplied by reference to the item number of this report.

All items have been fitted with a RED colour coded identification tag. We shall contact you early February 2027 to arrange your next inspection. Should you require any further information please contact the undersigned.

Yours Truly

Hasan Ozbal
 Inspection Officer
 Email: hasano@alllifting.com.au
 Mobile: 0403 208 495
 Phone: (02) 9838 4735



Full Member



ABN 48 795 006 590

1/177 Power St, Glendenning, NSW, 2761
Phone: (02) 9838 4735

Full Member

Report: 258654 / UNIT 950

Customer: RAR CRANES AUSTRALIA

Date of Inspection: 09/02/2026

| Item | ID Number | Description | W.L.L. | D.O.W. | Location | Insp. Date | Insp. Due | Comments | P/F/R/N |
|------|-----------|---|------------------|--------|----------|------------|-----------|--------------------|---------|
| 1 | J884 | CHAIN SLING 10MM 2 LEG GR-100 C/W LARGE OBLONG MULTI LINK EYE GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 8MTR | 6.9 TONNE @ 60° | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 2 | K438 | CHAIN SLING 10MM 2 LEG GR-100 C/W LARGE OBLONG MULTI LINK EYE GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 8MTR | 6.9 TONNE @ 60° | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 3 | K284 | CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOK EACH END GR-100 C/W | 4 TONNE | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 4 | K287 | CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOK EACH END GR-100 C/W | 4 TONNE | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 5 | K288 | CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOK EACH END GR-100 C/W | 4 TONNE | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 6 | K289 | CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOK EACH END GR-100 C/W | 4 TONNE | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 7 | 248 | CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOK EACH END GR-80 C/W | 3.2 TONNE | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 8 | 249 | CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOK EACH END GR-80 C/W | 3.2 TONNE | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 9 | 299 | CHAIN SLING 13MM 2 LEG GR-80 C/W OBLONG LINK EYE GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 6MTR | 9.2 TONNE @ 60° | N/A | UNIT 950 | 09/02/2026 | 02/2027 | NEEDS CLEVIS GRABS | Pass |
| 10 | 300 | CHAIN SLING 13MM 2 LEG GR-80 C/W OBLONG LINK EYE GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 6MTR | 9.2 TONNE @ 60° | N/A | UNIT 950 | 09/02/2026 | 02/2027 | NEEDS CLEVIS GRABS | Pass |
| 11 | 5167.1 | CHAIN SLING 16MM 2 LEG GR-100 C/W OBLONG LINK CLEVIS GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 8MTR | 17.3 TONNE @ 60° | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 12 | 5167.2 | CHAIN SLING 16MM 2 LEG GR-100 C/W OBLONG LINK CLEVIS GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 8MTR | 17.3 TONNE @ 60° | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 13 | 8661.1 | CHAIN SLING 16MM IN-LINE SHORTENER GR-100 C/W SHORTENING IN LINE CLEVIS SHORTENING CLUTCH | 10 TONNE | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 14 | 8661.2 | CHAIN SLING 16MM IN-LINE SHORTENER GR-100 C/W SHORTENING IN LINE CLEVIS SHORTENING CLUTCH | 10 TONNE | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 15 | K9 | LIFTING COMPONENT OBLONG LINK 26-32 GR-80 | 36.7 TONNE @ 60° | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |
| 16 | K9 | LIFTING COMPONENT OBLONG LINK 26-32 GR-80 | 36.7 TONNE @ 60° | N/A | UNIT 950 | 09/02/2026 | 02/2027 | N/A | Pass |

1300 666 733 • www.alllifting.com.au



Full Member



ABN 48 795 006 590


1/177 Power St, Glendenning, NSW, 2761
Phone: (02) 9838 4735



Full Member

Inspection Chart

Repair Fail No Presented Pass

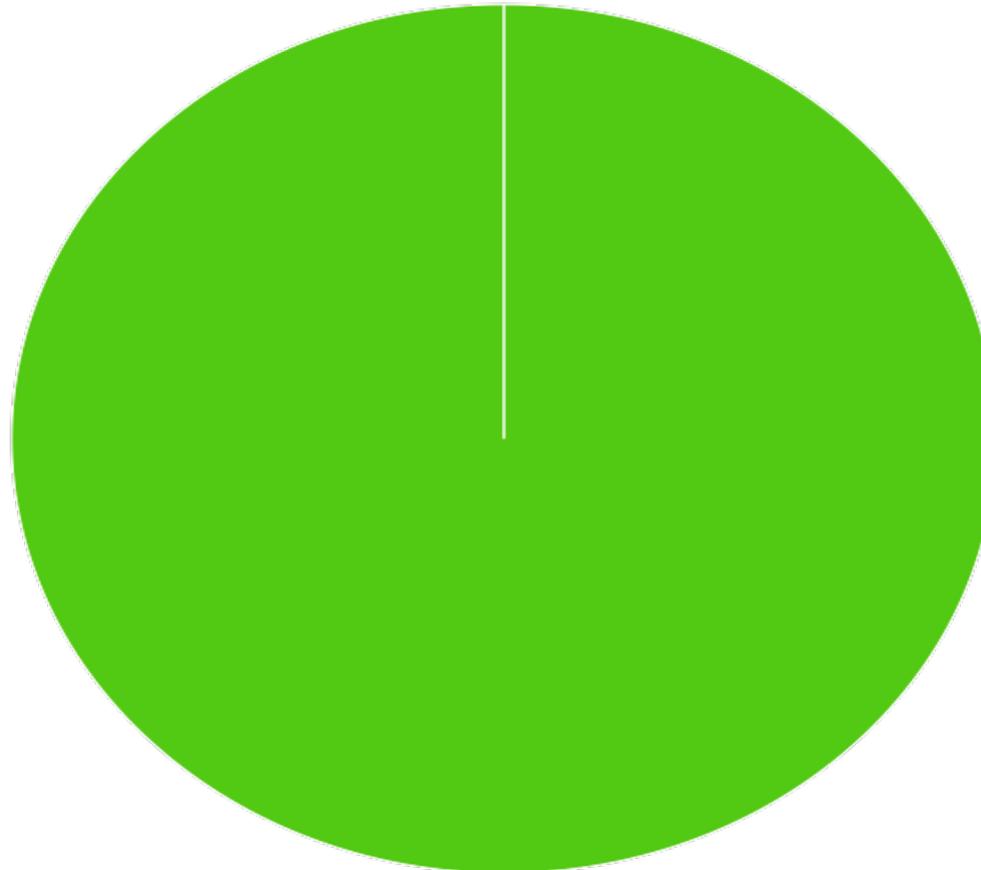

| Report No | 258654 / UNIT 950 |
|---------------|-------------------|
| Repair | 0 |
| Not Presented | 0 |
| Pass | 16 |
| Failed | 0 |
| TOTAL | 16 |

1300 666 733 • www.alllifting.com.au