



Full Member



ABN 48 795 006 590

1/177 Power St, Glendenning, NSW, 2761  
Phone: (02) 9838 4735



Full Member

## VISUAL INSPECTION REPORT

Customer:	RAR CRANES AUSTRALIA	Contact:	JAMES S
Location:	UNIT 980	Inspection Date:	09/02/2026
D/D No:	N/A	Report No:	258654 / UNIT 980
Report Received by:	andrewb@rargroup.com.au	Customer O/N:	N/A
Next Inspection Due:	FEBRUARY 2027	Colour Code:	RED

This report follows the visual inspection of lifting gear performed by Hasan Ozbal. Inspections were conducted with reference to Company endorsed Work Instructions, Relevant Standards, Occupational Health & Safety requirements and Manufacturers recommendations to determine acceptance / rejection criteria's.

1. AS 3775.2:2014 Chain slings for lifting purposes - grade T(80) and V(100) product specification
2. AS 4991-2004 Lifting Devices

All items satisfying the above requirements were tagged or hard stamped to cross reference with this report.

Items listed as "R" (Repair) should be quarantined and repaired prior to further use.

Items listed as "F" (Failed) are not suitable for continued use or for their intended purpose and should be destroyed and discarded immediately. We cannot accept any responsibility for continued use.

Items listed as "N" (Not Presented) were unable to be located on site.

Items listed as "P" (Pass) are suitable for continued use and can be put back into service. Should any replacement parts be required they can be supplied by reference to the item number of this report.

All items have been fitted with a RED colour coded identification tag. We shall contact you early February 2027 to arrange your next inspection. Should you require any further information please contact the undersigned.

Yours Truly

Hasan Ozbal  
Inspection Officer  
Email: hasano@alllifting.com.au  
Mobile: 0403 208 495  
Phone: (02) 9838 4735

1300 666 733 • [www.alllifting.com.au](http://www.alllifting.com.au)



Full Member



ABN 48 795 006 590

1/177 Power St, Glendenning, NSW, 2761  
Phone: (02) 9838 4735



Full Member

Report: 258654 / UNIT 980

Customer: RAR CRANES AUSTRALIA

Date of Inspection: 09/02/2026

Item	ID Number	Description	W.L.L.	D.O.W.	Location	Insp. Date	Insp. Due	Comments	P/F/R/N
1	19440	CHAIN SLING 10MM 2 LEG GR-80 C/W OBLONG LINK EYE GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 8MTR	5.5 TONNE @ 60°	N/A	UNIT 980	09/02/2026	02/2027	BOTH HOOKS REPLACED	Pass
2	19445	CHAIN SLING 10MM 2 LEG GR-80 C/W OBLONG LINK EYE GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 8MTR	5.5 TONNE @ 60°	N/A	UNIT 980	09/02/2026	02/2027	BOTH HOOKS REPLACED	Pass
3	K282	CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOKS AT BASE GR-100 C/W	4 TONNE	N/A	UNIT 980	09/02/2026	02/2027	N/A	Pass
4	K283	CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOKS AT BASE GR-100 C/W	4 TONNE	N/A	UNIT 980	09/02/2026	02/2027	N/A	Pass
5	K285	CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOKS AT BASE GR-100 C/W	4 TONNE	N/A	UNIT 980	09/02/2026	02/2027	N/A	Pass
6	K285	CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOKS AT BASE GR-100 C/W	4 TONNE	N/A	UNIT 980	09/02/2026	02/2027	N/A	Pass
7	K288	CHAIN SLING 10MM CHEATER CHAINS C/W CLEVIS SELF LOCKING HOOKS AT BASE GR-100 C/W	4 TONNE	N/A	UNIT 980	09/02/2026	02/2027	N/A	Pass
8	275	CHAIN SLING 13MM 2 LEG GR-80 C/W OBLONG LINK EYE GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 8MTR	9.2 TONNE @ 60°	N/A	UNIT 980	09/02/2026	02/2027	N/A	Pass
9	276	CHAIN SLING 13MM 2 LEG GR-80 C/W OBLONG LINK EYE GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 8MTR	9.2 TONNE @ 60°	N/A	UNIT 980	09/02/2026	02/2027	N/A	Pass
10	S1477.1	CHAIN SLING 16MM 2 LEG GR-100 C/W OBLONG LINK EYE GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 8MTR	17.3 TONNE @ 60°	N/A	UNIT 980	09/02/2026	02/2027	TAG REPLACED	Pass
11	S1477.2	CHAIN SLING 16MM 2 LEG GR-100 C/W OBLONG LINK EYE GRAB HOOK/S CLEVIS SELF LOCKING HOOK/S 8MTR	17.3 TONNE @ 60°	N/A	UNIT 980	09/02/2026	02/2027	N/A	Pass
12	PL16C2187C	LIFTING DEVICE FRANNA BEAM	15 TONNE	N/A	UNIT 980	09/02/2026	02/2027	N/A	Pass

1300 666 733 • [www.alllifting.com.au](http://www.alllifting.com.au)



Full Member



ABN 48 795 006 590


1/177 Power St, Glendenning, NSW, 2761  
Phone: (02) 9838 4735



Full Member

## Inspection Chart

Repair Fail No Presented Pass

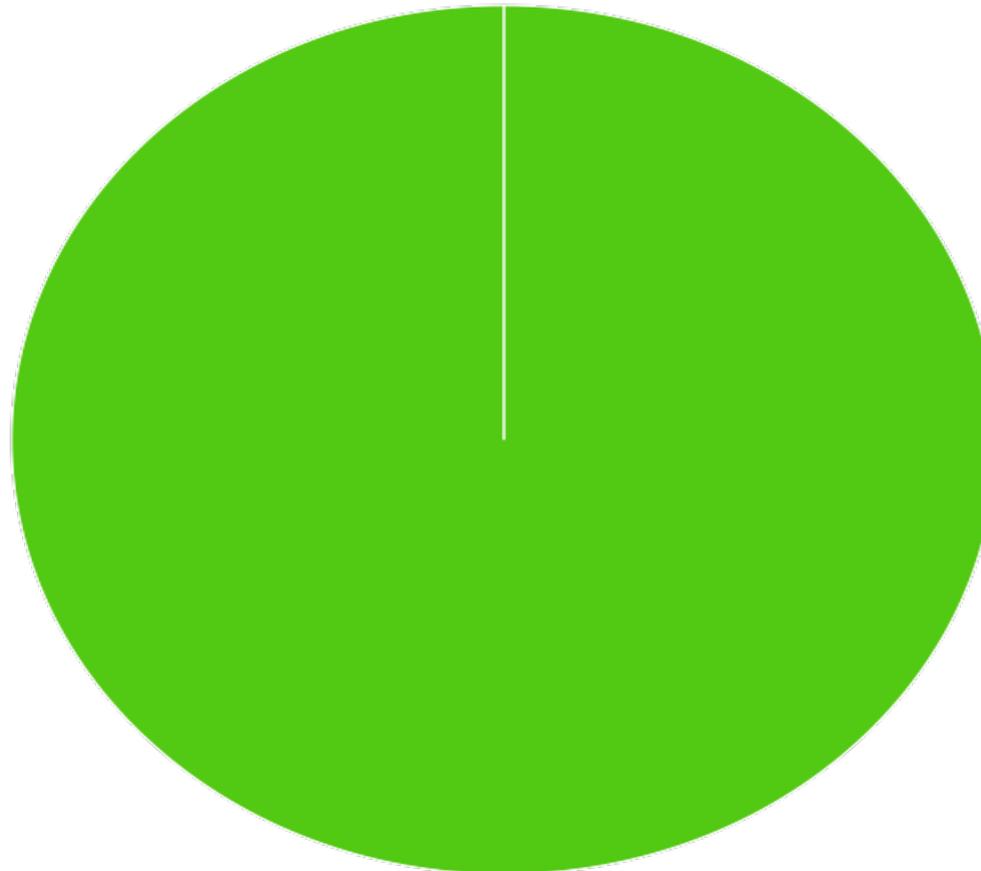

Report No	258654 / UNIT 980
Repair	0
Not Presented	0
Pass	12
Failed	0
TOTAL	12

1300 666 733 • [www.alllifting.com.au](http://www.alllifting.com.au)